

Inspection Reference
6914586

Report prepared for
GENEVIEVE MILLER

On vehicle
MERCEDES-BENZ SPRINTER

Registration
1HC8GW



Purpose of Inspection: **Prior to Purchase**

Name of inspector
Tim G

Telephone
0414 657 235

This inspection was carried out at
45/3 JACKMAN ST SOUTHPORT 4215

On
18/05/2022 11:27 AM

If you have any questions regarding this report, please contact the inspector on the phone number listed.

Important information you need to know about this report

The Vehicle Inspection Report will not tell you about hidden and concealed defects, intermittent problems not apparent at the time of inspection, problems which cannot be identified on a visual inspection or unless parts of the vehicle are dismantled, or which become manifest after inspection. Items that are not checked as part of the inspection;

- oil and fuel consumption
- source of oil leaks
- oil pump strainer for any build-up of sludge
- engine cylinder compression,
- vehicle electrics and electronics using specific diagnostic equipment;
- bodywork water leaks or their source
- odometer accuracy
- timing belt/timing chain/cam belt
- brake pads, linings and contact surfaces (Mobile Inspections)
- brake components that cannot be easily seen without removing or dismantling parts or covers
- wheel alignment
- the life expectancy of exhaust systems, clutches or dual mass flywheels
- operation of in car entertainment or media systems
- sound or radio reception
- the operation and accuracy of satellite navigation systems
- advanced driver assistance systems, electronic driving aids, radars, and sensors
- alarm systems or anti-theft devices
- the accuracy of in-car computer systems
- exhaust emissions, using gas analysing equipment, catalytic converters, LPG systems, diesel particular filters
- air conditioning efficiency using specific diagnostic equipment
- the habitation area of motor homes or campervan section of the vehicle
- auxiliary batteries, hybrid batteries or power, electric vehicle batteries or power and remote control batteries
- the quality of any repairs or replacements
- any manufacturer recalls or any other recalls that have affected, or may affect the vehicle in any way
- hybrid or electric vehicle charging equipment
- non-standard accessories/parts as a result of personal modifications or otherwise
- tyre pressures and tyre pressure monitoring systems
- roof heights greater than 2.4m
- wheels that require removal on dual wheel axles
- age of tyres
- any type of bearing
- electric motors that propel the vehicle or electric motors that are concealed
- locking differentials (diff locks)
- 4x4 vehicles fitted with dual range transfer cases and/or center locking differentials are checked for engagement but are not driven in these settings, to prevent damage to the vehicle's driveline. Proper testing of these components needs to be conducted on an unsealed surface in varying conditions which is not completed as part of this inspection.

Please see our full Terms and Conditions of this vehicle inspection report by clicking the link below.

<https://www.racq.com.au/cars-and-driving/products-and-services/vehicle-inspections>

Reason for inspection

Prior to Purchase

Registration

1HC8GW

Odometer

224,020

Build Date

Not Sighted

Cylinders

4

Make & Model

MERCEDES-BENZ SPRINTER

Registration expiry date

Not Sighted

Compliance plate date

04 / 2016

VIN / serial number

WDB9066332P251632

Transmission

AUTOMATIC

The following definitions are used when dealing with the items listed below. Scratches/Paint Chips to the vehicles paintwork will only be recorded if they are considered excessive by the Inspector.

- OK** Items that have been deemed in good working order, which are consistent for the age and condition of the vehicle.
- NA** Not applicable to your vehicle
- X** Defects which, in our opinion, should be rectified prior to the vehicle's continued use or purchase.
- O** Other items noted – items that should be drawn to your attention as they have a cosmetic imperfection or components that are serviceable but will require future attention.

Used car safety ratings are available at <http://www.racq.com.au/cars-and-driving>

Inspection Result

Electrical			Road test			Underbody		
2	X	Interior/Exterior Lights	16	OK	Ease of Starting	30	OK	Axle Bearings
3	OK	Battery	17	OK	Engine Performance	31	OK	Drive Shafts, Universals, CV Joints
4	OK	Wipers, Washers	18	OK	Drive Train Operation	32	NA	Clutch Controls
5	OK	Horn	19	OK	Steering and Suspension	33	OK	Brake Master Cylinder, Pipes & Fittings
6	OK	Heater, Demister System	20	OK	Speedometer, Odometer (visual)	Engine		
7	OK	Air Conditioning	21	OK	Brake Operation			
8	OK	Dash Warning Lights/Gauges	Underbody			34	OK	Power Balance
Body			22	OK	Panels	35	OK	Engine Noises
			23	OK	Frame and Members	36	OK	Engine Fumes, Exhaust Smoke
9	O	Overall Paint Condition	24	OK	Exhaust System	37	OK	Oil Level, Condition, Seals
10	O	Panels	25	O	Front Suspension	38	OK	Mountings
11	O	Doors, Locks	26	OK	Rear Suspension	39	OK	Visual Emission Components
12	OK	Glass, Mirrors	27	OK	Shock Absorbers	40	OK	Cooling System, Water Hoses
13	O	Interior Condition	28	OK	Steering Components	41	OK	Auxiliary Drive Belts
14	O	Seats, Seat Belts	29	O	Drivetrain	42	O	Fuel System
15	OK	Exterior Trim				43	OK	Ignition System
						44	OK	Diagnostic Scan

Issues identified with this vehicle

X Defect Present - Attention Required

2 Interior/Exterior Lights Leftside Indicator Lights Indicator lens cracked



Indicator lens cracked

O Other Items Noted

9	Overall Paint Condition	Paint	Refer Inspectors Comments
9	Overall Paint Condition	Various Panels	Minor chips and scratches noted
10	Panels	Left rear Door Panels	Dent in door panel
10	Panels	Right Side Door Panels	Dent in door panel
10	Panels	Right Side	Dents in panels
11	Doors, Locks	Left rear Door Sealing Rubber	Door rubber split
11	Doors, Locks	Right front Door Sealing Rubber	Door rubber split
11	Doors, Locks	Doors, Locks	Refer Inspectors Comments
13	Interior Condition	Centre Console	Console lid hinges broken
13	Interior Condition	Service book/manual	Service books/manuals incomplete
13	Interior Condition	Various Upholstery / Trim	Burn marks in trim,General wear and tear to trims
14	Seats, Seat Belts	Right front Seat Belt Webbing	Webbing frayed on edges
25	Front Suspension	General Suspension	General wear noted to bushes / mounts / components
29	Drivetrain	Transmission Oil	Advise check service records,Not checked due to manufacturers design
42	Fuel System	Air Filter Air Cleaner	Unable to inspect air filter element, workshop attention required



Refer Inspectors Comments



Refer Inspectors Comments



Refer Inspectors Comments



Minor chips and scratches noted



Minor chips and scratches noted



Minor chips and scratches noted



Dent in door panel



Dent in door panel



Dent in door panel



Dent in door panel



Dents in panels



Door rubber split



Door rubber split



Refer Inspectors Comments



Refer Inspectors Comments



Console lid hinges broken



Burn marks in trim,General wear and tear to trims



Burn marks in trim,General wear and tear to trims



Burn marks in trim,General wear and tear to trims



Burn marks in trim,General wear and tear to trims



Webbing frayed on edges




Burn marks in trim, General wear and tear to trims



Unable to inspect air filter element, workshop attention required

Tyre Condition

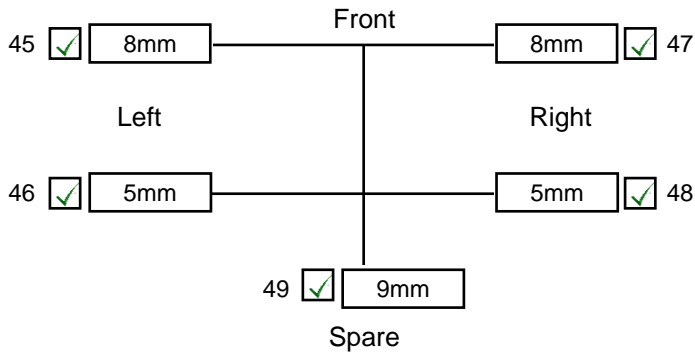

Battery Condition

No Data Available

Body Condition Rating



Mechanical Condition Rating



Additional Information

Log Books	Road Test Speed	Drive Train	Keys Tested
Log books supplied	60km/h	Rear Wheel Drive (2WD)	1

Vehicle Summary

PAINT... evidence of remaining glue from possible previous sign writing/wrap.

DOORS... dents with poor paint repairs evident to right front B pillar and right front door.

Advanced Driver Assistance Systems and Electronic Driving Aids are not tested as part of this inspection

The vehicles battery was not tested due to location and accessibility

This vehicle is considered to be in a reasonable condition

Transmission fluid not checked due to manufacturers design

We highly recommend a Car History Checks be carried out on all used vehicles prior to purchase to assist in determining the vehicles history. Car History Checks are available from RACQ by calling on 1800 629 501

General wear and tear noted to suspension bushes. This is typical for a vehicle of this age

No visible coolant leaks at time of inspection

RACQ advises further inspection with vehicle dealer/manufacture if any outstanding recalls have been performed prior to purchasing.

This vehicle appears to have recent underbody / engine wash. We are unable to comment on any previous conditions that may have been evident prior to washing

Vehicle Photos



Cover Photo



right front



odometer before road test



right rear



service sticker





engine oil level ok



left rear



brake fluid ok



left front



oil staining on turbo outlet hose, advise clean and monitor





right front



left front



left rear



right rear



no diagnostic trouble codes present at time of inspection



air conditioning operating and cold at time of inspection

